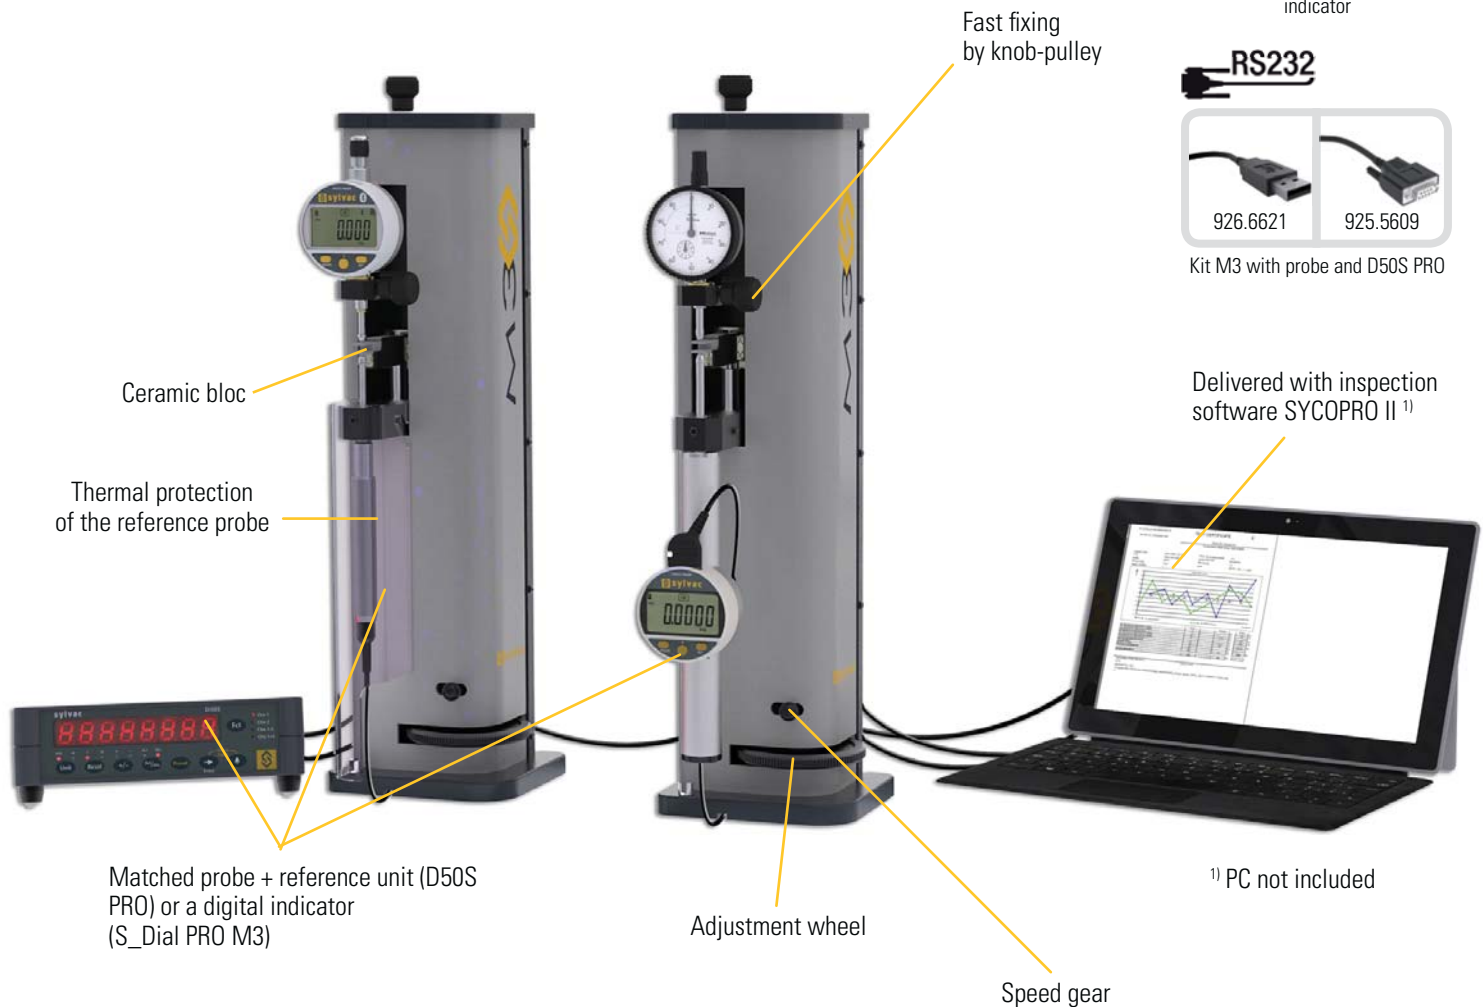


Digital indicator testing stand M3

DESCRIPTION

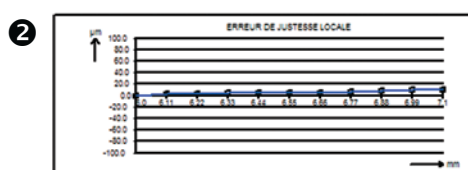
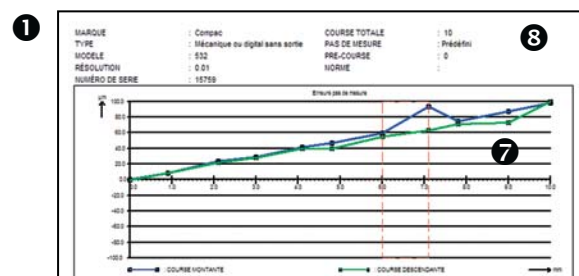
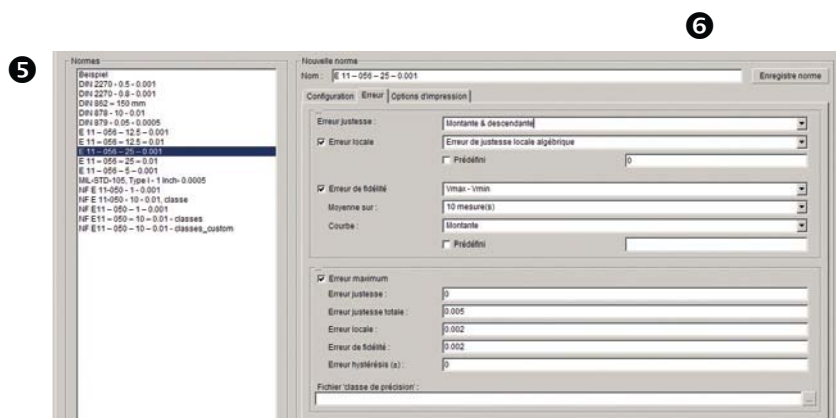
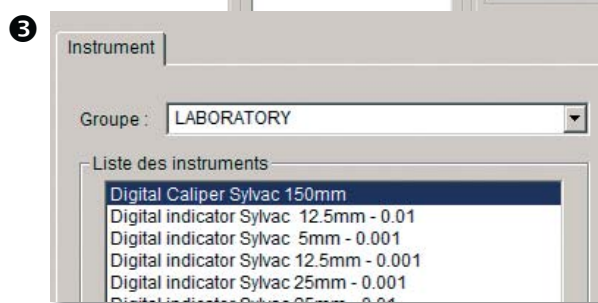
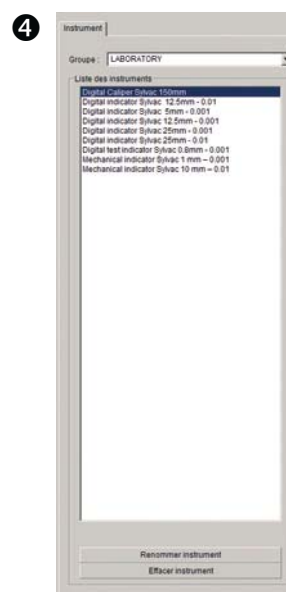
- Control thanks to a probe 10mm, 25mm or a digital indicator 25mm, 50mm
- Suitable for testing dial gauges plunger type and test indicators
- Allows the use of 2 calibrated measuring probes (like P25 and P25)
(P10 calibrated on channel 1 and P50 calibrated on channel 2) (version D50S PRO)
- Testing system according to ABBE principle
- Can be used in vertical and horizontal position
- Ceramic gauges blocs
- Direct status from the instrument during checking
- Integrated standards
- Creation of personalized certificates of inspection
- Fast and slow approach speeds
- Visualization at any time of the control status
- Control of digital instruments with direct connection



Digital indicator testing stand M3

DISPLAY/SOFTWARE

- 1 Display the curves of measurement
- 2 Check the error and repeatability
- 3 Creation and management of instrument groups
- 4 Fast access to all of stored instruments
- 5 Integrated standards
- 6 Personalisation of the standards
- 7 Display the measured values
- 8 Possibility to customize the certificate

TECHNICAL SPECIFICATIONS

		Kit with probe and D50S PRO		Kit with digital indicator	
		809.1303	809.1301	809.1305	809.1304
Measuring range	mm	M3 Kit probe 10 mm	M3 Kit probe 25 mm	M3 Kit S_Dial PRO M3 25 mm	M3 Kit S_Dial PRO M3 50 mm
Max. Error	μm	0.6	0.8	1.0	1.2

Digital indicator testing stand M3

BASIC INSTRUMENT

Kit with probe and D50S PRO

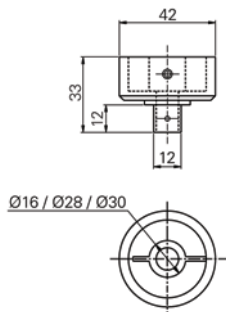
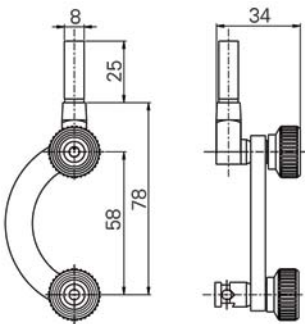
- Stand M3 (909.1300)
- Ceramic bloc gauges
- Thermal protection of the probe reference
- D50S PRO + probe calibrated
- Cable RS232C (925.5609)
- Charging unit according to country (904.4200/01/03/04/05)
- External contact (foot-pedal 904.4101)
- CD- with inspection software SYCOPRO II (981.7124)
- Accessory for lever indicators (909.2010)
- Instruction manual

Kit with digital indicator

- Stand M3 (909.1300)
- Ceramic bloc gauges
- S_Dial PRO M3 with special measuring force
- Cable Proximity USB (926.6721)
- External contact (foot-pedal 926.7020)
- CD- with inspection software SYCOPRO II (981.7124)
- Accessory for lever indicators (909.2010)
- Instruction manual

B

ACCESSORIES



909.2010

Clamping device for test indicator

909.2011

Clamping device for dial gauges Ø 16 / 28 / 30 mm